




Certified Inspection Report For: Llanharry Community Council Groes Sannor, Degar Road Llanharry, Pontyclun, Mid Glamorgan CF72 9JX			Contact: Gill Lewis Tel: 01443 223 007 Mobile: E-mail: llanharrycc@live.co.uk Order No: 322799		Site Address:  The Recreation Field (Opp shops) junction of Sycamore Road Ty Isaf, Llanharry CF72 9LJ			SHEET 1 of 2	
DESCRIPTION OF PRODUCTS INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY	PRODUCT CODE	DESCRIPTION OF PARTS REQUIRED	UNIT PRICE	TOTAL	
Teen Shelter on Tarmac	Unknown		Satisfactory condition.					£0.00	
Ball Court on Tarmac	Unknown	M	Inspected to the requirements and recommendations of BS EN 15312: 2007 + A1: 2010 relating to Free access multi-sports equipment. A clearly visible sign shall be provided in a prominent position, including at least the following: This equipment is not intended for children less than 3yrs Warning "Do not climb on the framework or nets" Warning "Do not hang on the ring" (if provided) Warning "Do not wear rings or other jewellery as these can get caught and cause injury" Name and phone number of administrator/maint contact; Phone number to call in case of accident. (Ref BS EN 15312: 2007 + A1: 2010 (E) Section 8)			(Customer Information Only) Refer to Wicksteed Sales Department for further details on Signs.			
High Pedestal Slide on Black Wet pour	Wicksteed 2005/6	M	Satisfactory condition.			Refer to Manufacturer for Spare Parts			
Cable Runway on Black Wet pour	Record 2008	MH	Seat suspension chain has been replaced but is too long being knotted to raise this creates entanglement hazards ground clearance should be 400mm min with a load of 130kg at centre of cable, current height is 300mm.	1	5082-330	(Customer Information Only) Cableway Seat & Twist Link Chain Assembly	£144.00		
		L	Monitor corrosion from inside one terminus upright.						
		L	Monitor gaps in safety surface approx 28m						
Multiplay Unit Ref RP692 on Black Wet pour	Record 2003	M	Damage to barrier upright (yellow) recommend repair.						
Roundabout Ref RP426 on Black/Blue Fleck Wet pour	Record 2004	L	Ground Clearance (BS EN 1176 Part 5: 2008 Sec 5.2.3) Ground clearance below deck should be between 60mm and 110mm, for a distance of 300mm towards centre of its rotation. Clearance on this unit is currently 50mm, to 120 mm this is due to bearing wear recommend monitor			Refer back to manufacturer for spares			
		L	Monitor gaps around edge of safety surface.						
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a>			<b>INDICATION OF RISK RATING ASSESSMENT</b> MH/H MEDIUM HIGH & HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY : <b>M.ALLBRIGHT</b> DATE : <b>20/10/2015</b>		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS		£0.00 £0.00 £0.00 <b>See Sheet 2</b>
Continues on next sheet...									

Certified Inspection Report For: Llanharry Community Council Groes Sannor, Degar Road Llanharry, Pontyclun, Mid Glamorgan CF72 9JX			Contact: Gill Lewis Tel: 01443 223 007 Mobile: E-mail: llanharrycc@live.co.uk Order No: 322799		Site Address:  The Recreation Field (Opp shops) junction of Sycamore Road Ty Isaf, Llanharry CF72 9LJ			SHEET 2 of 2	
DESCRIPTION OF PRODUCTS INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY	PRODUCT CODE	DESCRIPTION OF PARTS REQUIRED	UNIT PRICE	TOTAL	
Ben Nevis Climber on Black Wet pour	Wicksteed 2005/6		Satisfactory condition.						
1.9m 1 Bay Swing 2 x Cradle Seats on Black Wet pour	G L Jones	M	Safety surface area lifting/gaps around edges approx 22m x 100mm x 45mm recommend area is cut back and in-filled to help prevent slip/trip/fall hazards.	4 2	6130.201 6130.200	Top layer Repair Kit - (TLRK) Black Base layer repair kit - black <b>Labour cost to cut back wet pour &amp; infill as detailed*</b>	£56.00 £110.00 <b>£640.00</b>	<b>£224.00</b> <b>£220.00</b>	
2.4M 1 Bay Metal Swing 2 x Flat Seats on Wet pour	Unknown	L MH MH	Monitor shackle/bush support & surface wear under seats. Seat eyebolts rotate recommend tighten or replace. Corrosion in swing top bar recommend repair or replace.			Note:- base layer repair kits have been quoted as a precaution - any unused kit(s) will be refunded			
Duck Spring Mobile on Red / Black Wet pour	Playworld Systems		Satisfactory condition.						
Seahorse Spring Mobile on Red / Black Wet pour	Playworld Systems		Satisfactory condition.						
4 x Free Standing Swing Barriers	Unknown		Satisfactory condition.						
3 x Seats	Unknown	L	Monitor damage/dents repair as required.						
Picnic Table	Unknown		Satisfactory condition.						
1 x Litter Bin	Unknown		Satisfactory condition.						
Fence	Unknown		Satisfactory condition.						
2 x Gates	Unknown		Satisfactory condition.						
Vehicle Access Gate	Unknown		Satisfactory condition but recommend this is kept locked when not in use to prevent unauthorised access.						
Operators sign	Unknown		Satisfactory condition.						
 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a>			<b>INDICATION OF RISK RATING ASSESSMENT</b> MH/H MEDIUM HIGH & HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY : <b>M.ALLBRIGHT</b> DATE : <b>20/10/2015</b>		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS TOTAL COST EXCLUDING A VAT		<b>£444.00</b> <b>£0.00</b> <b>£444.00</b> <b>£640.00</b> <b>£1,084.00</b>

